

SSM 50059 - 2016-2017 Various Vehicles - Body Control Module Programming Error

Some 2016-2017 Ford and Lincoln vehicles with a new Body Control Module (BCM) installed may exhibit a programming error using IDS v122.03 and newer stating "Data Corrupt" or "Configuration Failed, would you like to retry?". A temporary work around has been released to complete the BCM programming process. Uninstall IDS from the computer. Run the IDS clean up utility tool located on PTS > Rotunda Tab > Diagnostic Tool Support > IDS Support > IDS troubleshooting guide. Install IDS v122.01 (122_FULL) by copying the following link into an internet address bar https://www.fordservicecontent.com/Ford_Content/IDS/SoftwareUpdates/IDS-122.01_full.exe. Retry the BCM Programmable Module Installation (PMI) using IDS level122.01. Monitor OASIS for updates.

APPLICABLE VEHICLES

2016 CAR: DQ CD539N EDGE
2016 TRUCK: UB U502N EXPLORER
2016 TRUCK: FC P552N F-150
2016 CAR: D9 U540N MKX
2016 CAR: ZG S550N MUSTANG
2016 TRUCK: UB U502N EXPLORER
2017 CAR: C7 CD391N FUSION
2017 TRUCK: ME C489N MKC
2017 CAR: C9 CD533N MKZ